Bristol Freighter, Type 170 Mk 31M, C-FDFC, 18 July 1996

AAIB Bulletin No: 10/96 Ref: EW/G96/07/15 Category: 1.1

Aircraft Type and Registration:	Bristol Freighter, Type 170 Mk 31M, C-FDFC
No & Type of Engines:	2 Bristol Hercules 734 piston engines
Year of Manufacture:	1955
Date & Time (UTC):	18 July 1996 at 1035 hrs
Location:	Enstone Airfield, Chipping Norton, Oxfordshire
Type of Flight:	Private
Persons on Board:	Crew - 2
	Passengers - 6
Injuries:	Crew - None
	Passengers - 3 Minor
Nature of Damage:	Substantial airframe damage
Commander's Licence:	Airline Transport Pilot's Licence
Commander's Age:	51 years
Commander's Flying Experience:	11,000 hours (of which 1,300 were on type)
	Last 90 days - 130 hours
	Last 28 days - 45 hours
Information Source:	Aircraft Accident Report Form submitted by the pilot and telephone enquiries by the AAIB

The weather at the departure airfield consisted of a light andvariable wind, good visibility and a temperature of 20°C. At the start of the take-off run the aircraft, which was beingflown by the copilot, who is also an experienced pilot with some60 hours on type, began to swing to the right. Corrective actioncaused it to swing to the left but, after further correction, the aircraft continued accelerating and swing to the right. TheBristol Freighter is well known for its tendency to swing on takeoff. The commander joined the co-pilot on the controls and attempted assist in correcting the right-hand swing. It became apparent to the pilots that they would be unable to prevent the aircraftrunning over the edge of the runway and, as there were peoplestanding by the edge and a small control tower building behindthem, they applied full up-elevator in an effort to avoid a collision. Because of the low airspeed at which this occurred, the aircraftstalled and the left wing tip hit the ground. This caused theaircraft to turn so that it was then travelling sideways

which resulted in the landing gear collapsing as it touched the runway. The aircraft then slid off the runway onto the grass. Therewas no fire and the only injuries were sustained by three of the aircraft passengers.