



AIRCRAFT ACCIDENT INVESTIGATION SUMMARY REPORT

V116/793/1029

Publication of this report is authorised by the Secretary under the provisions of Air Navigation Regulations 283 (1)

1. LOCATION OF OCCURRENCE

Eight km south-east of Essendon Airport, Victoria	Height a.m.s.l. 141 feet	Date 10.8.79	Time (Local) 1508 hours	Zone EST
---	-----------------------------	-----------------	----------------------------	-------------

2. THE AIRCRAFT

Make and Model Aero Commander 500S	Registration VH-ALH	Certificate of Airworthiness Valid from 6.8.76
Certificate of Registration issued to	Operator	Degree of damage to aircraft Destroyed
		Other property damaged Nil
Defects discovered Nil		

3. THE FLIGHT

Last or intended departure point Flinders Island	Time of departure 1329 hours	Next point of intended landing Essendon	Purpose of flight Carriage of freight	Class of operation Aerial Work
---	---------------------------------	--	--	-----------------------------------

4. THE CREW

Name	Status	Age	Class of licence	Hours on type	Total hours	Degree of injury
	Pilot		First Class Airline Transport	100 (approx)	8500 (approx)	Fatal

5. OTHER PERSONS (All passengers and persons injured on ground)

Name	Status	Degree of injury	Name	Status	Degree of injury
	Passenger	Fatal			

6. RELEVANT EVENTS

During the morning of 9.8.79, the aircraft was refuelled to capacity and three drums, each with a capacity of 20 litres, were also filled with fuel and placed in the baggage compartment. The aircraft, loaded with freight, subsequently departed Essendon at 1335 hours and proceeded to Cambridge where it arrived at 1536 hours. The freight was unloaded and, at 1621 hours, the aircraft departed for Launceston where it arrived at 1653 hours. It was again loaded with freight and departed Launceston at 1720 hours bound for Flinders Island. The aircraft landed at Flinders Island several minutes after the end of daylight, which was at 1745 hours, and the freight was unloaded.

On the following day, the aircraft was again loaded with freight and the pilot subsequently reported departure from Flinders Island at 1329 hours, bound for Essendon. The take-off run was observed to be longer than usual for this type of aircraft and its rate of climb appeared to be less than normal. The IFR flight plan notified by the pilot before departure indicated his intention to cruise at an altitude of 4500 feet but, at 1410 hours, he reported to Melbourne Flight Service Unit "request traffic for a descent to proceed VFR we're getting 50 knot head wind here". On being advised that there was no traffic information, the pilot reported leaving 4500 feet.

At 1502 hours, the pilot established communication with Essendon Tower, reported approaching Channel 0 at 1500 feet, and "request expedite clearance". He was issued with a clearance to enter controlled airspace at 1500 feet tracking from Channel 0 to Essendon via Clifton Hill. At 1506 hours he reported at Clifton Hill and, at 1507:38 hours, he advised "I'm sorry have a Mayday appear to have a fuel problem we'll have to land on a golf course". On being asked "which golf course?", the pilot replied "oh right where we are now". No further communications were received from the aircraft.

The aircraft was observed by witnesses in the Northcote area initially on a north-westerly heading towards Essendon. It was seen to be descending and the sound of the engines was not normal. After flying over the northern section of the Northcote Municipal Golf Course, the aircraft commenced a descending left turn and passed over a power transmission line which ran in a north-south direction near the western boundary of the golf course. As the turn continued towards an easterly heading, the aircraft again passed over the power line, at a very low height, and in strong tail wind conditions struck trees bordering a fairway while in a slightly left wing

6. RELEVANT EVENTS (cont'd)

down, nose down, attitude. It struck the ground heavily just beyond the trees and the main wreckage travelled a further 73 metres before it came to rest on the edge of a green in the south-eastern corner of the golf course.

Detailed examination of the wreckage of the aircraft revealed no evidence of any defect or malfunction which may have contributed to the accident. There was no significant fuel in the fuel systems of the two engines and there was negligible fuel in those cells of the fuel storage system which were undamaged. There was no fire.

The pilot was in full time employment as an airline captain with a major operator. He was also involved financially and managerially in Norfish Pty. Ltd. and both he and the Company had financial difficulties at that time. The flight plan submitted by the pilot before departure from Essendon on 9.8.79 contained false names in respect of both the pilot and the operator. Neither the pilot nor Norfish Pty. Ltd. held a Charter or Aerial Work Licence.


The maximum specified take-off weight for the aircraft was 3357 kg. for VFR operations and 3243 kg. for IFR operations. It has been calculated that the gross weight of the aircraft was 3775 kg. when it departed Essendon for Cambridge on 9.8.79 and 3746 kg. when it departed Launceston for Flinders Island on the same day. The calculated gross weight was 4061 kg. when it departed Flinders Island on the day of the accident.

Although fuel was available at Cambridge and Launceston, the aircraft was not refuelled after it departed from Essendon. The three 20 litre drums were located in the aircraft wreckage and, although all were damaged, detailed examination indicated that they ruptured under the action of hydraulic shock and that they were filled at the time of the accident. The total operating time of the aircraft from departure Essendon until the time of the accident was consistent with a fuel endurance which could be expected in the circumstances leading to this accident.

7. OPINION AS TO CAUSE

The cause of the accident was that the aircraft was operated with insufficient fuel to safely complete the flight.

Approved for
publication

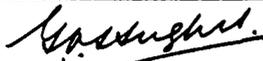

(G.V. Hughes)
Delegate of the Secretary

Date

12.1.1981

DEFINITIONS

ACCIDENT - An occurrence associated with the operation of an aircraft which takes place between the time any person boards the aircraft with the intention of flight until such time as all those persons have disembarked and in which

- (a) any person suffers death or serious injury as a result of being in or upon the aircraft or by direct contact with the aircraft or anything attached to the aircraft; or

Note. - Specifically excluded are: death from natural causes and fatal or serious injury to any person on board whether self-inflicted or inflicted by another person, or to ground support personnel before or after flight, or fatal or serious injury which is not a direct result of the operation of the aircraft, or which concerns stowaways.

- (b) the aircraft suffers substantial damage or is destroyed; or
- (c) the aircraft is missing or is completely inaccessible.

FATAL INJURY - Any injury which results in death within 30 days.

SERIOUS INJURY - Any injury other than a fatal injury which

- (a) requires hospitalisation for more than 48 hours, commencing within seven days from the date the injury was received; or
- (b) results in a fracture of any bone (except simple fractures of fingers, toes or nose); or
- (c) involves lacerations which cause severe haemorrhages, nerve, muscle or tendon damage; or
- (d) involves injury to any internal organ; or
- (e) involves second or third degree burns, or any burns affecting more than five percent of the body surface.

MINOR INJURY - Any injury other than as defined under "Fatal Injury" or "Serious Injury".

DESTROYED - Consumed by fire, demolished or damaged beyond repair.

SUBSTANTIAL DAMAGE - Damage or structural failure which adversely affects the structural strength, performance or flight characteristics of the aircraft and which would normally require major repair or replacement of the affected component. The following types of damage are specifically excluded: engine failure; damage limited to an engine or its accessories, or to propeller blades; bent fairings or cowlings; small dents or puncture holes in the skin; damage to wing tips, antennas, tires, or brakes.

MINOR DAMAGE - Damage other than as defined under "Destroyed" or "Substantial Damage".